
### **High Level Sewershed**

Run Summary —								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-056	Smoke	9/8/2008	ADS/TM	S13EE1009MH	Dry	Yes	1,475.45	

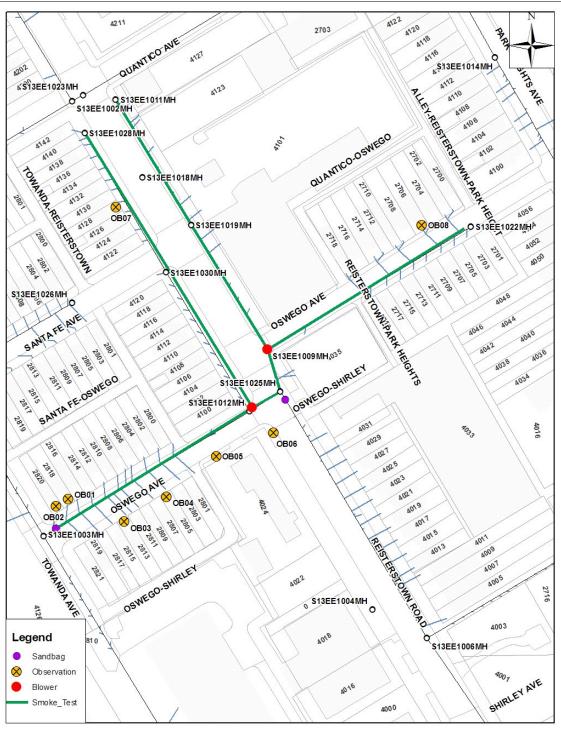

### **High Level Sewershed**

Run Summar	iry ————						
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-056	Smoke	9/8/2008	ADS/TM	S13EE1009MH	Dry	Yes	1,475.45

Isol	ated Pipes —				
	Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
	S13EE1028G1	S13EE1028MH	S13EE1030MH	200.9511	8
	S13EE1009G1	S13EE1009MH	S13EE1025MH	55.47086	8
	S13EE1030G1	S13EE1030MH	S13EE1012MH	205.7203	8
	S13EE1011G1	S13EE1011MH	S13EE1019MH	185.4517	8
	S13EE1022G1	S13EE1022MH	S13EE1009MH	291.7693	8
	S13EE1019G1	S13EE1019MH	S13EE1009MH	185.1321	8
	S13EE1012G1	S13EE1012MH	S13EE1003MH	310.0064	8
	S13EE1025G1	S13EE1025MH	S13EE1012MH	40.94375	8

#### **Observations & Photos**

**Obs\_ID** S1028-056-OB01 **Address** 2818 Oswego Ave

**Status** Private **Source** Cleanout

**Location** Yard - front **Nearest MH** S13EE1003MH

**Comments** Smoke from cleanout in front yard. 2818

Oswego Ave



**Picture** \S1028-056-OB01-P01.jpg

**Comments** Front of house, 2818 Oswego Ave

**Obs\_ID** S1028-056-OB02 **Address** 2820 Oswego Ave

**Status** Private **Source** Cleanout

**Location** Yard - front **Nearest MH** S13EE1003MH

Comments Smoke from cleanout in front yard. 2820

Oswego Ave



**Picture** \S1028-056-OB02-P01.jpg

**Comments** Front of house, 2820 Oswego Ave

#### **High Level Sewershed**

Kuii Suiiiiiai	у —						
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-056	Smoke	9/8/2008	ADS/TM	S13EE1009MH	Dry	Yes	1,475.45

Obs\_ID S1028-056-OB03

Address 2813 Oswego Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S13EE1003MH

**Comments** Smoke from cleanout in front yard. 2813

Oswego Ave



**Picture** \S1028-056-OB03-P01.jpg

Comments Front of house, 2813 Oswego Ave

**Obs\_ID** S1028-056-OB05 **Address** 4024 Reisterstown Rd

StatusPrivateSourceArea DrainLocationPaved concrete

Nearest MH S13EE1012MH

**Comments** Smoke from area drain in paved concrete near

building. 4024 Reisterstown Rd

AR Was It was the black with the bla

**Picture** \S1028-056-OB05-P01.jpg

**Comments** Smoke observed 10 ft. from the

building under large sheet of metal. Side of building, 4024

Reisterstown Rd

**Obs\_ID** S1028-056-OB04

**Address** 2805 Oswego Ave **Status** Private


Source Cleanout

Location Yard - front

Nearest MH S13EE1003MH

**Comments** Smoke from cleanout in front yard. 2805

Oswego Ave

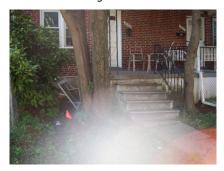

**Picture** \S1028-056-OB04-P01.jpg

**Comments** Front of house, 2805 Oswego Ave

**Obs\_ID** S1028-056-OB06

Address Oswego Ave & Reisterstown Rd

Status Public
Source Catch Basin
Location Curb

Nearest MH S13EE1012MH

**Comments** Smoke from catch basin along curb on SW corner of Oswego Ave & Reisterstown Rd



**Picture** \S1028-056-OB06-P01.jpg

**Comments** Oswego Ave & Reisterstown Rd

looking west



#### **High Level Sewershed**

#### **Run Summary**

Kan Sammary							
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-056	Smoke	9/8/2008	ADS/TM	S13EE1009MH	Dry	Yes	1,475.45

**Obs\_ID** S1028-056-OB07 **Obs\_ID** S1028-056-OB08 Address 2706 Oswego Ave Address 4128 Reisterstown Rd Status Private Status Private Source Cleanout Source Cleanout Location Yard - front Location Yard - front Nearest MH S13EE1030MH Nearest MH S13EE1022MH

Smoke from cleanout in front yard. 4128 Smoke from cleanout in front yard. 2706 Comments

Reisterstown Rd Oswego Ave



**Picture** \S1028-056-OB07-P01.jpg

Comments Front of house, 4128

Reisterstown Rd



**Picture** \S1028-056-OB08-P01.jpg

**Comments** Front of house, 2607 Oswego Ave